

Diagnosis report of 2019 VOLVO XC90 Inscription



Car details

Color: Grey	CO ₂ NEDC Emission: 158 g/km
Fuel type: Diesel	CO ₂ WLTP Emission: 208 g/km
Body type: SUV	Gross Vehicle Weight (GVW): 2750 kg
Number of doors: 5	Engine size: 2.00 l
Number of seats: 7	Cylinders: 4
Mileage: 206 926 km	Power: 173 kw
VIN Code: YV1LF68UCK1451621	Fuel consumption: 6.00 l/100km
Gearbox: Automatic	Tire size: 275/45 - 20"
Drive type: All-Wheel Drive	Longo Stock ID: N496313
Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of 2019 VOLVO XC90 Inscription



Diagnosis details

Mileage on completion date: 206 926 km
Checked by Longo Shared Service certified diagnostics team: Eimantas A., Arnas S., Mindaugas G.

This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.

Summary of diagnosed issues

During the comprehensive diagnosis conducted by Longo, 17 issues were identified in the vehicle.

Interior	Exterior	Mechanical
✔ 7 issues identified	✔ 3 issues identified	✔ 7 issues identified

Diagnosis process



Interior

- ✔ 1. Front: Steering Wheel - Condition



✔ **2. Front:** Window Wiper Rubber and Handle (Front and Rear) - Condition



✔ **3. Front:** Window Wiper Rubber and Handle (Front and Rear) - Condition




✔ **4. Seats:** All Seats - Condition




✓ **5. Inside:** Armrest - Operation and Condition



✓ **6. Doors:** Trims - Condition

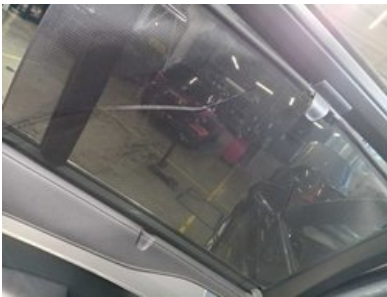

✓ **7. Doors:** Trims - Condition

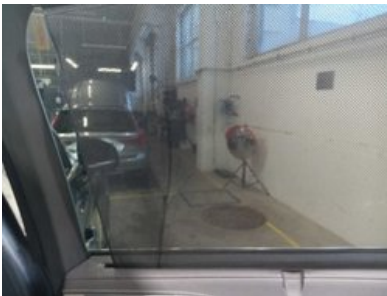

Exterior

✓ 1. Rear: Rear Bumper - Condition and Alignment



✓ 2. Front: Front Bumper - Condition and Alignment




✓ 3. Side: Left and Right Side - Visual Damage and Scratches





✔ **4. ENGINE:** Mounting - Left (of Engine Bay)

✓ **5. ENGINE:** Camshaft Valve Cover & Gasket

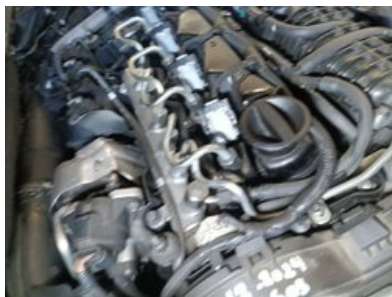

✓ **6. BRAKES:** Front Brake Discs Both with Pads



✓ **7. SUSPENSION:** Suspension Lower Arm Both





Other

✓ **1. Add AdBlue**

✓ 2. Brake Test Line Results



✓ 3. Diagnostic Photo

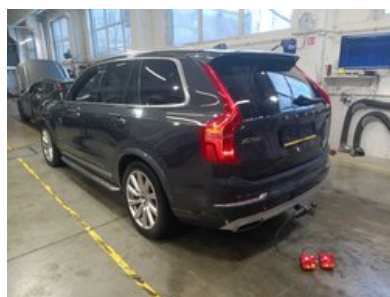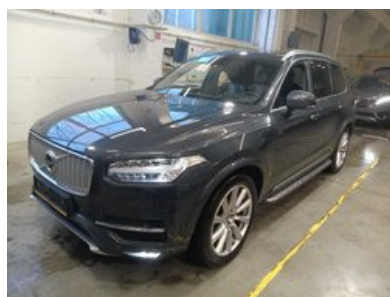

✓ 4. Air-Conditioning Measurement



✓ 5. Add Photo of Front Interior



Preparation and repair report of 2019 VOLVO XC90 Inscription



Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Mechanical repairs

- ✓ 1. Change Tires
- ✓ 2. Charge Battery
- ✓ 3. Left Engine Bay Mounting
- ✓ 4. Change Front Wiper (Mechanical)
- ✓ 5. Suspension Lower Arm (Both)

Cleaning & polishing

- ✓ 1. Body wet wash
- ✓ 2. Full interior deep clean using only hypoallergenic cleaning products
- ✓ 3. Post cleaning body polish

Spare parts used during preparation

- 1. AdBlue 9L
- 2. Wiper (VAL577892)
- 3. Engine Cushion (FE184164)
- 4. Tire KUSTONE 275/45R20 110W PASSION P9S XL (KU000001)

Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.


Additional information about **2019 VOLVO XC90 Inscription**



Additional pictures







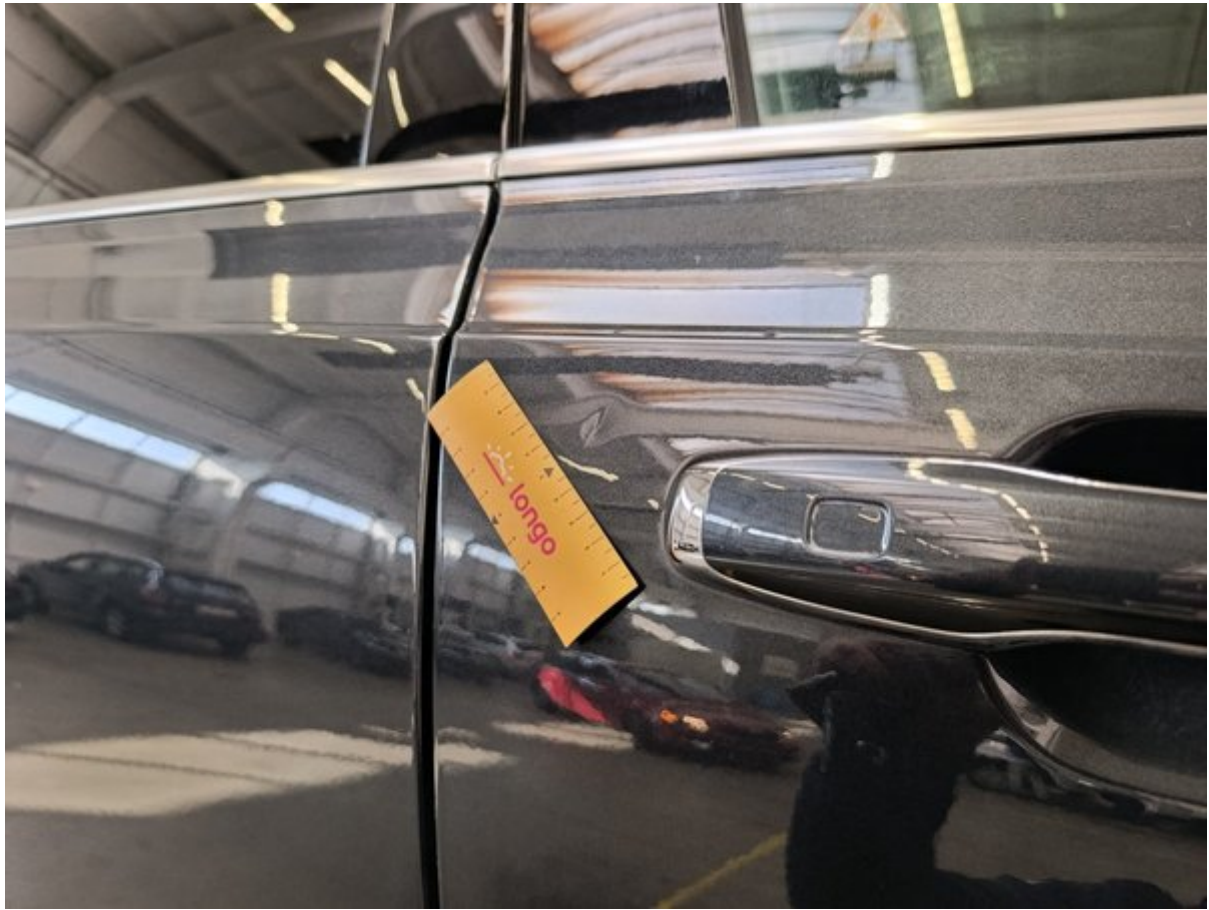





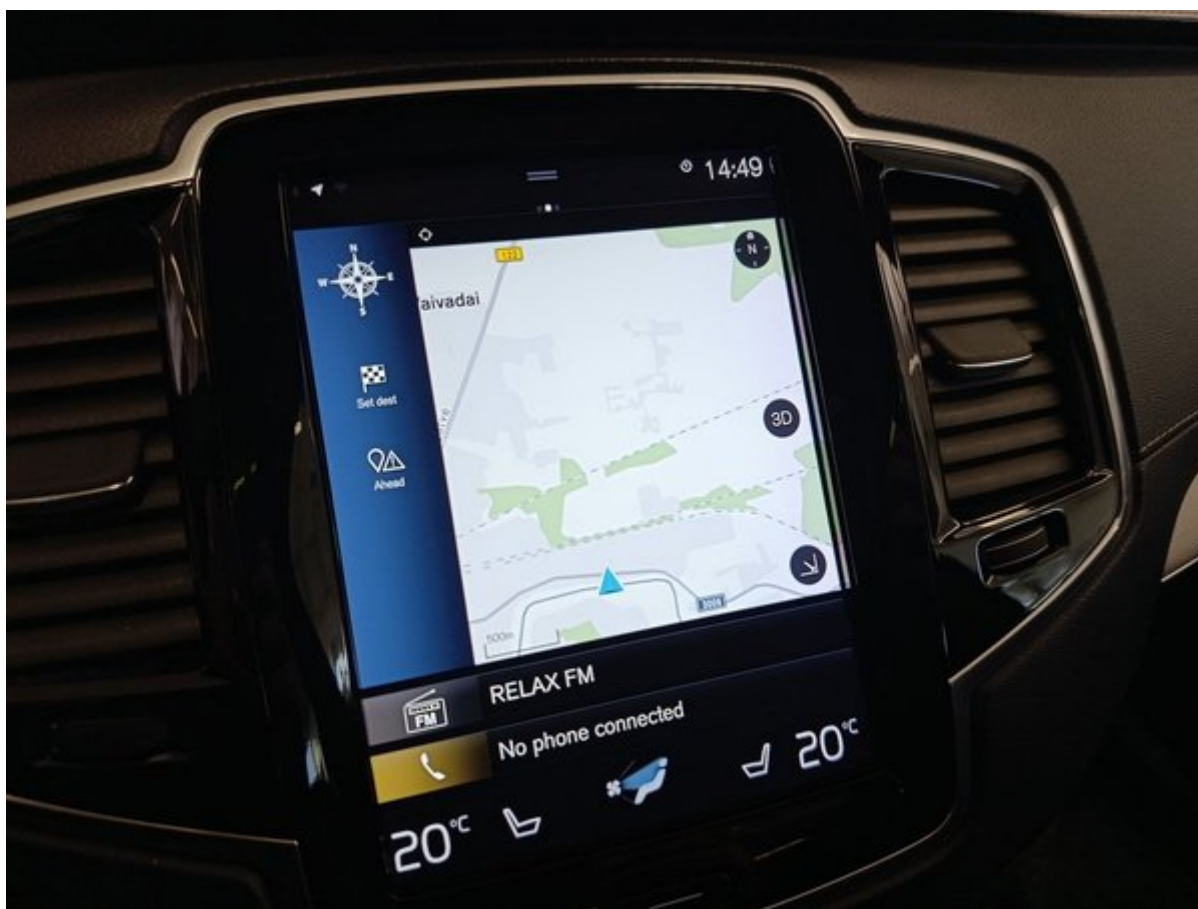

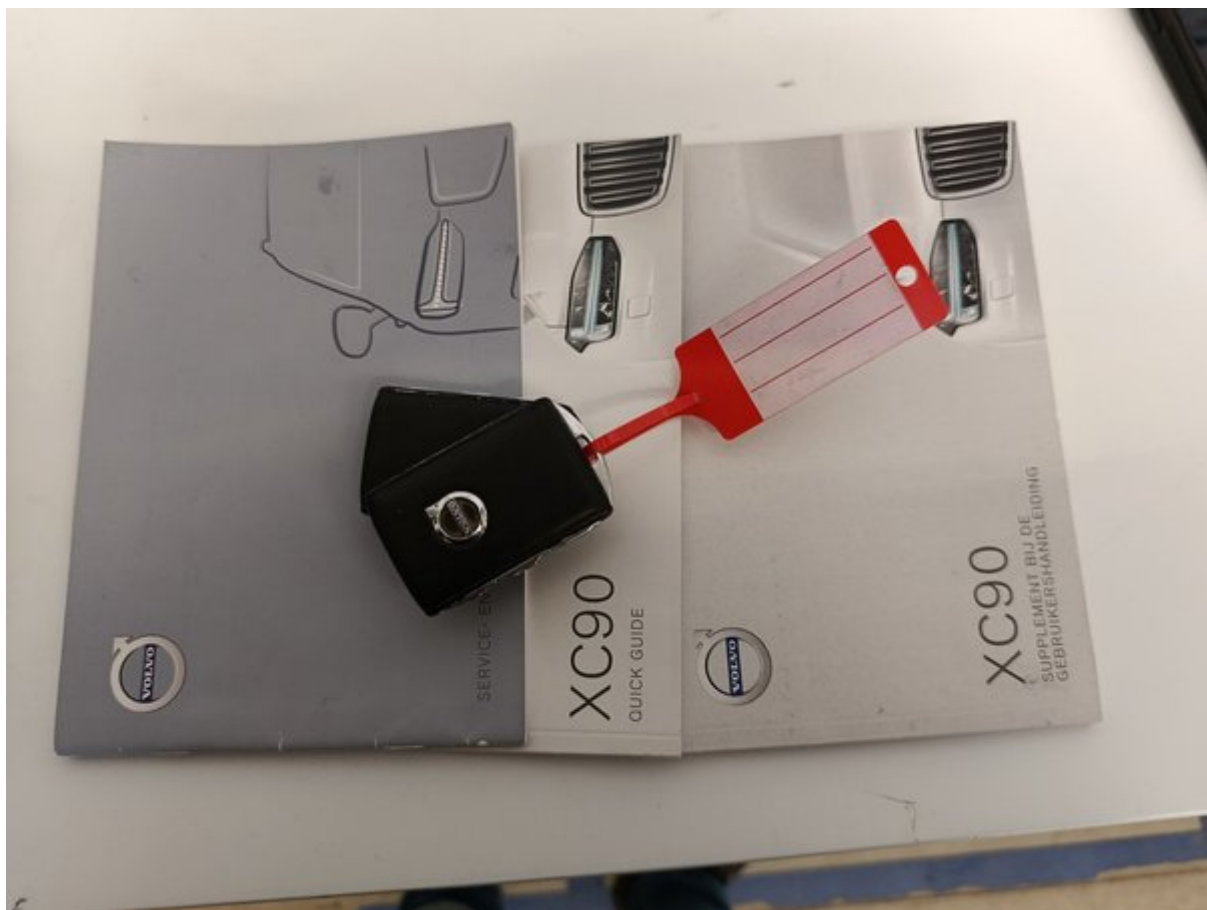

SERVICE EN ONDERHOUD

Servicebewijs

Zorg dat de formulieren na iedere onderhoudsbeurt worden afgestempeld en getekend door uw Volvo-dealer of Volvo Erkend Hersteler.

De Volvo-dealer kan u informeren over de inhoud van Volvo Original Service voor uw auto.

Vergeet niet onderhoud te verrichten volgens de onderhoudsintervallen.

Servicebeurt nr. 1

Uitgevoerd
Km 26122

Datum 6-1-20

Werkorder nr. 764799

Soort servicebeurt 2595

Reguliere service

Servicebeurt nr. 2

Uitgevoerd
Km 45948

Datum 29-12-2020

Werkorder nr. 772445

Soort servicebeurt

Reguliere service

Mobility Centre De Jong Rotterdam B.V.

Officieel dealer Volvo Cars

Hoofdweg 137
3067 GD Rotterdam
Tel.: 010 - 850 45 50

Mobility Centre De Jong Rotterdam B.V.

Officieel dealer Volvo Cars

Hoofdweg 137
3067 GD Rotterdam
Tel.: 010 - 850 45 50

Extra verversings-/vervangingsbeurt olie/filt:

Opmerking

Extra verversings-/vervangingsbeurt olie/filt:

Opmerking

SERVICE EN ONDERHOUD

Servicebeurt nr. 3	Servicebeurt nr. 4	Servicebeurt nr. 5
Uitgevoerd Km: 64961	Uitgevoerd Km	Uitgevoerd Km
Datum: 10-11-21	Datum	Datum
Werkorder nr.: 779307	Werkorder nr.	Werkorder nr.
Soort servicebeurt: L593	Soort servicebeurt	Soort servicebeurt
Reguliere service	Reguliere service	Reguliere service
Extra vervangings-/vervangingsbeurt olie/filt.: STEMPEL	Extra vervangings-/vervangingsbeurt olie/filt.: STEMPEL	Extra vervangings-/vervangingsbeurt olie/filt.: STEMPEL
Opmerking STEMPEL	Opmerking STEMPEL	Opmerking STEMPEL

Mobility Centre De Jong Rotterdam B.V.
Officieel dealer Volvo Cars
Hoofdweg 137
3067 GD Rotterdam
Tel.: 010 - 850 45 50





Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be included or omitted.



Vehicle Identity & History

Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked

Exterior Condition

Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected

Interior Condition

Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked

Lights, Mirrors & Glass

Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		

Comfort & Electronics

Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	

Safety Equipment

Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)

Engine Bay & Fluids

Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	

Braking System

Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	

Steering & Suspension

Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		

Wheels & Tyres

Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		

Exhaust & Fuel System

Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		

Road Test & Driving Performance

Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	