Diagnosis report of
2009 BMW X5 High Executive

Car details

Color: Black	CO_2 NEDC Emission: 216 g/km
Fuel type: Diesel	
Body type: SUV	Gross Vehicle Weight (GVW): 2790 kg
Number of doors: 5	Engine size: 3.00 l
Number of seats: 5	Cylinders: 6
Mileage: 349 718 km	Power: 210 kw
VIN Code: WBAFF01050L212881	Fuel consumption: 8.20 l/100km
Gearbox: Automatic	Tire size: 235/60 - 18"
Drive type: All-Wheel Drive	Longo Stock ID: A729294
Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of
2009 BMW X5 High Executive

Diagnosis details

Mileage on completion date: 349 718 km

Checked by Longo Shared Service certified diagnostics team: Arnas S., Mantas G., Eimantas A., Mindaugas Š., Mindaugas G.

This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.


Summary of diagnosed issues

During the comprehensive diagnosis conducted by Longo, 42 issues were identified in the vehicle.

Interior	Exterior	Mechanical
12 issues identified	15 issues identified	15 issues identified

Diagnosis process



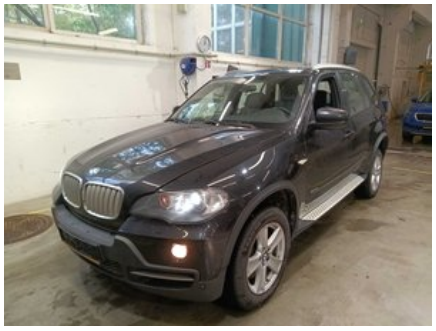

Interior

1. Front: Steering Wheel - Condition



2. Front: Window Wiper Rubber and Handle (Front and Rear) - Condition



3. Seats: All Seats - Condition





4. Seats: Seat Adjustment Mechanisms - Functioning





5. Seats: Seatbelts - Functioning and Locking Mechanism




6. Doors: Door Rubber Seals




7. Doors: Trims - Condition




8. Inside: Trims - Condition



9. Inside: Trims - Condition





10. Inside: Trims - Condition




11. Inside: Trims - Condition



12. Inside: Trims - Condition



Exterior

1. Side: Left and Right Side - Visual Damage and Scratches







2. Side: Left and Right Side - Visual Damage and Scratches





3. Side: Wheels - Condition






4. Front: Front Bumper - Condition and Alignment



5. Front: Windscreen Integrity - Free from MOT-Excluding Damage




6. Front: Firewall Integrity






7. Lights: Car Side Lights - Basic Functioning, Damage, and Color




8. Lights: Rear Lights (Brake, Fog, Indicator) - Basic Functioning, Damage, and Color

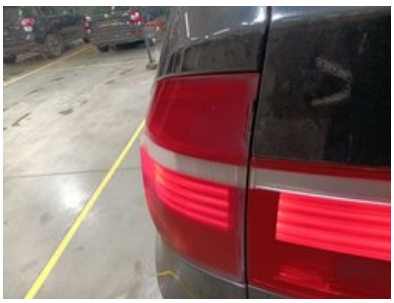

9. Lights: Rear Lights (Brake, Fog, Indicator) - Basic Functioning, Damage, and Color



10. Lights: Rear Lights (Brake, Fog, Indicator) - Basic Functioning, Damage, and Color



11. Rear: Trunk - Visual Damage





12. Rear: Trunk - Visual Damage



13. Other: Additional Polishing Tasks




14. Other: Additional Polishing Tasks

15. Other: Audible Signs (Loose Parts, Rattling, Etc.)



Mechanical

1. OTHER: Repair Wiring



2. OTHER: Engine Oil & Filter Change



3. AIR CONDITIONING AND HEATING: Condenser



4. AIR CONDITIONING AND HEATING: System Evacuation/Recharging

5. SUSPENSION: Suspension Lower Arm Both





6. SUSPENSION: Shock Absorber - Air Suspension



7. SUSPENSION: Anti-Roll Bar





8. SUSPENSION: Suspension Lower Arm Rear



9. SUSPENSION: Suspension Lower Arm Front



10. COOLING SYSTEM: Radiator



11. GENERAL ELECTRICS: Battery

12. GENERAL ELECTRICS: Parking Sensor







13. ENGINE MANAGEMENT - FUEL: Intake Manifold




14. BRAKES: Rear Brake Hose (Both)

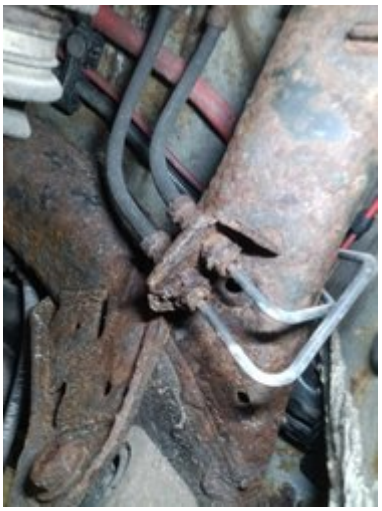

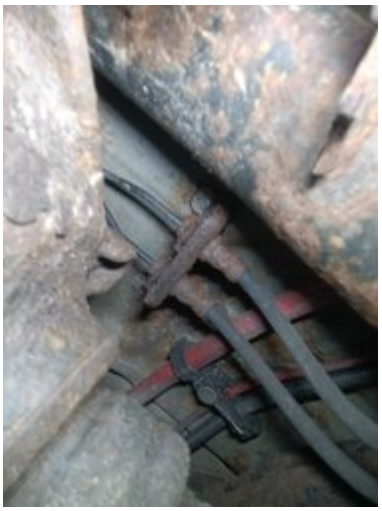

15. FINAL DRIVE, SHAFT & AXLES: Driveshaft - Left

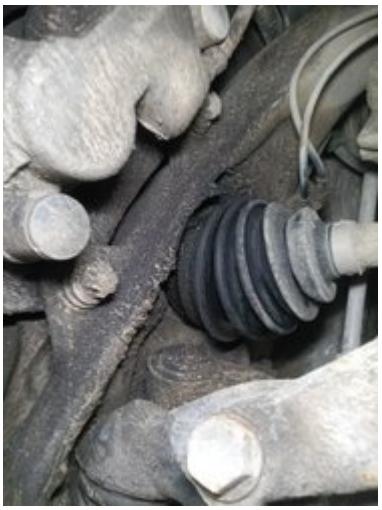

Other

1. Brake Test Line Results



2. Diagnostic Photo






3. Add Photo of Front Interior



Preparation and repair report of
2009 BMW X5 High Executive

Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Body & Interior

- 1. Change Lights on Car Side
- 2. BMW Logo
- 3. Trunk Emergency Opening Cover
- 4. Change Door Panel
- 5. Headlamp Alignment
- 6. Rear Light

Mechanical repairs

- 1. Repair Wiring
- 2. Intake Manifold
- 3. System Evacuation/Recharging
- 4. Engine Oil & Filter Change
- 5. Suspension Lower Arm, Rear
- 6. Condenser
- 7. Battery
- 8. Parking Sensor

Paintshop

- 1. Paint Front Bumper
- 2. Paint Rear Fender

Cleaning & polishing

- 1. Body wet wash
- 2. Full interior deep clean using only hypoallergenic cleaning products
- 3. Post cleaning body polish

Spare parts used during preparation

1. Oil Filter (OE649/8)
2. Engine Oil 7.5L
3. Refrigerant R134A (R134A)
4. Battery (AGM59520)
5. Turn Signal (TYC18-0458-00-9)
6. Handle (8800-00-0126202P)
7. Turn Signal (TYC18-0457-00-9)
8. Manufacturer Badge E70 7157696 (LGV111446)
9. Rear Light Left Hand (444-1939L-UE)
10. Air Conditioning Condenser (KTT110318)
11. Track Control Arm Left Hand (TC2229)
12. Track Control Arm Right Hand (TC2230)
13. Intake Manifold (FE173365)
14. E70 Rear Door Handle Trim 70P3142 (MKR7593)
15. Rear Light Left Outer (ZBM191093L)

16. Parking Sensor (120-01-004)


Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Additional information about
2009 BMW X5 High Executive

Additional pictures



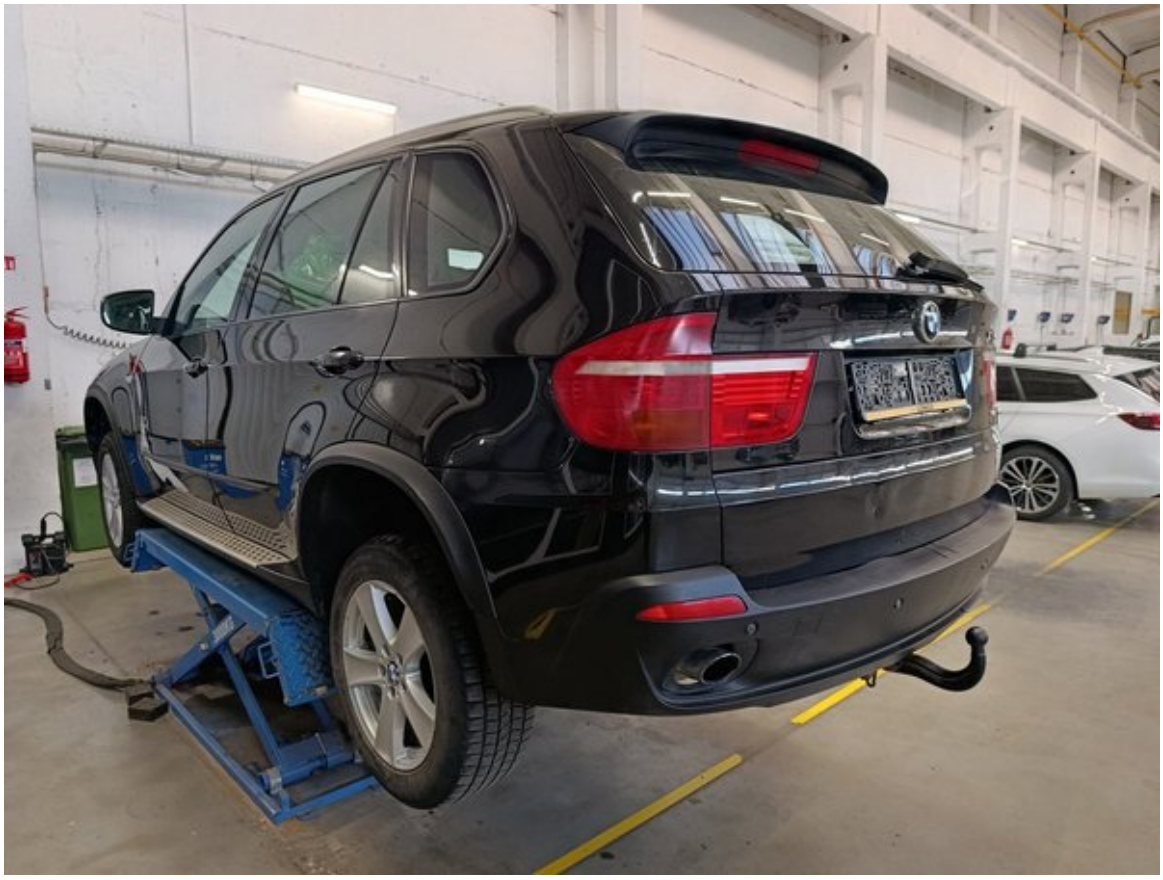


SAILUN 235/60R18




3000KG


longo


longo




longo


longo


longo


longo








WBAFF01050L212881
4702M398


km/h
15:29
+14.0 °C
P
349718 000.9
1/min x 1000
l/100km


Navigation
Computer
New destination
AFFERDEN
BERGHAREN,WIJCHEN, BREEKWAGEN 6
Route criteria
Map north-oriented
LOCAL-1
15:29
--:-- Arrival
88 km Range
-9... km To dest.
4.1 km/h Speed
39.5 l Consumpt.
22.10.2026


TotalEnergies
5W30
Next Oil Change
LOWGO
baltics.totalenergies.com












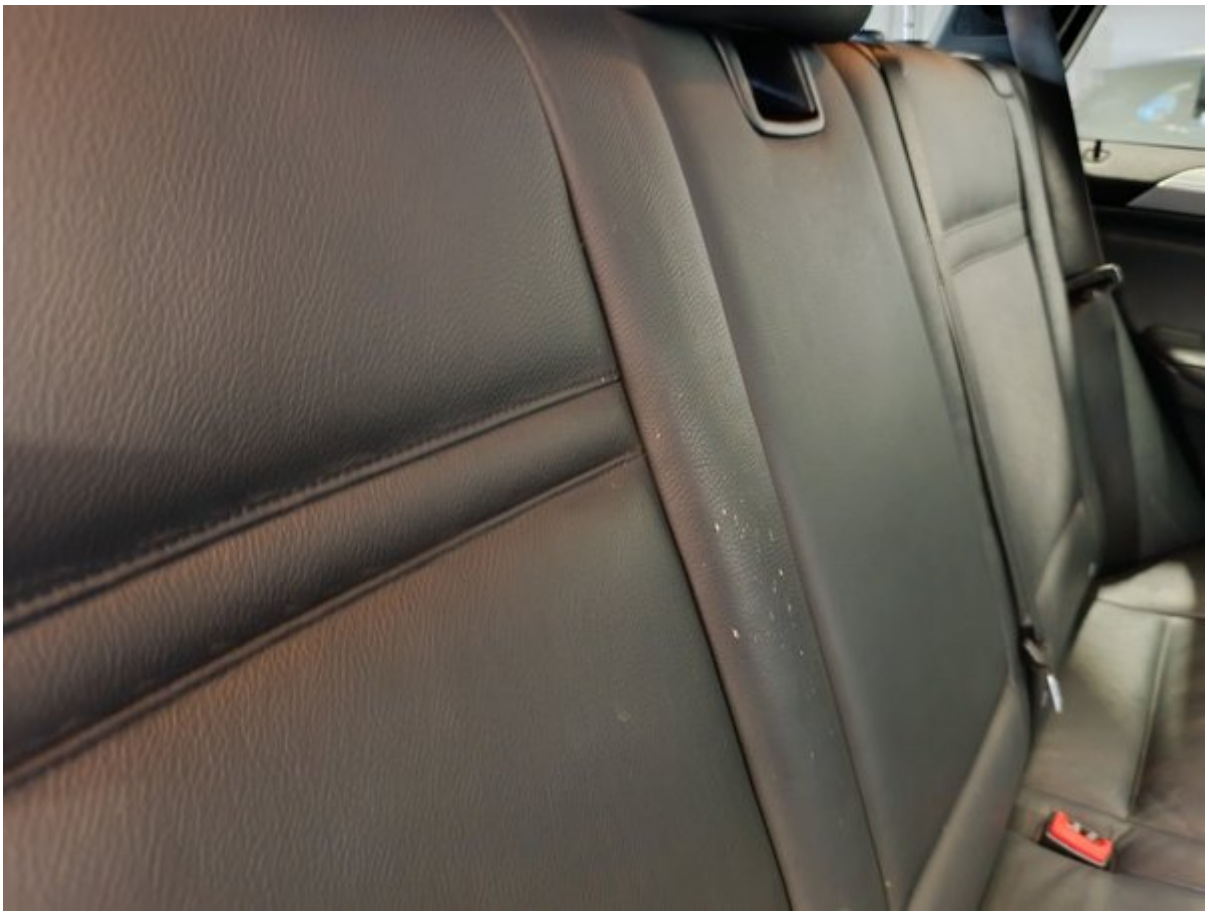




AUTO H
MENU


1
2
3
4
5
6
7
DTC



ENGINE
0


BMW
AIRBAG





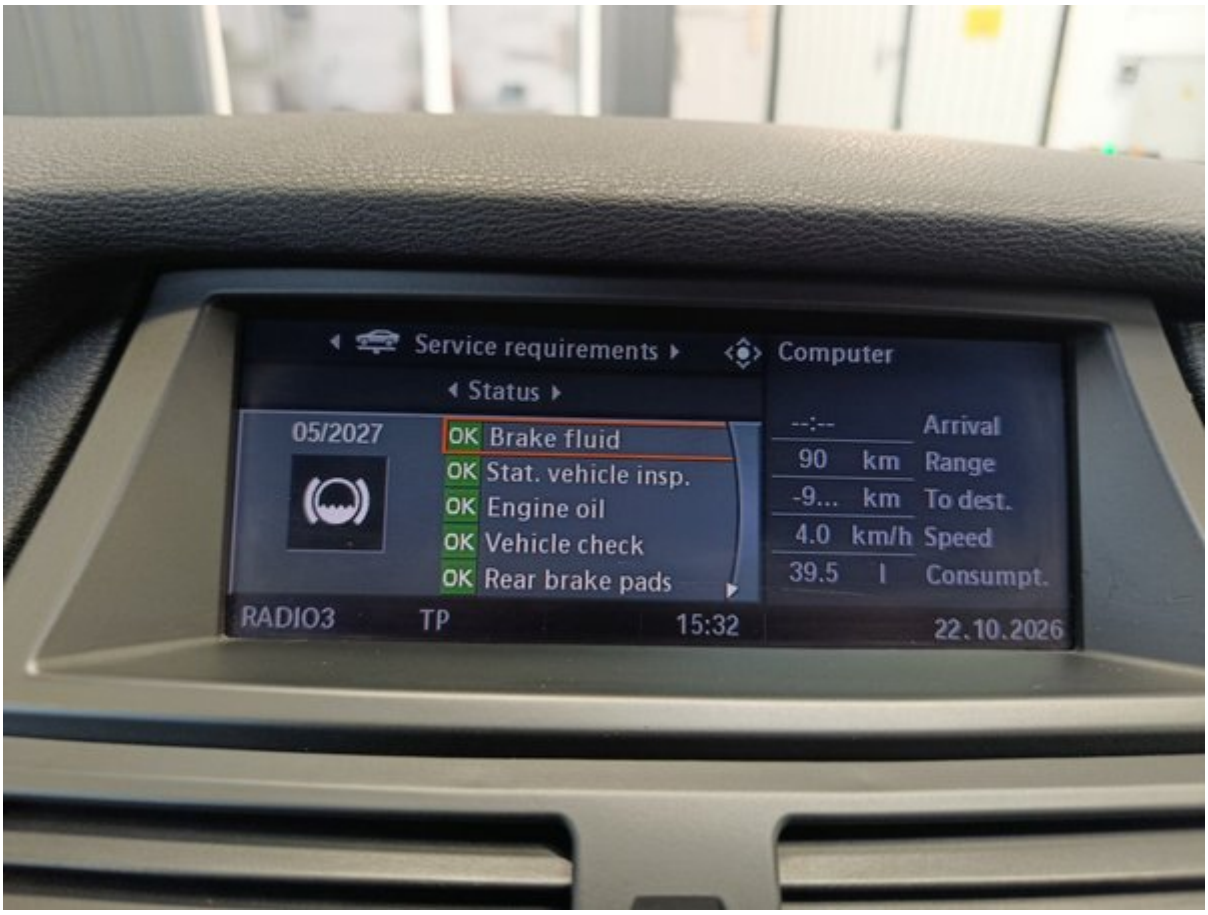


Service requirements
Computer
Status
05/2027
OK Brake fluid
OK Stat. vehicle insp.
OK Engine oil
OK Vehicle check
OK Rear brake pads
--:-- Arrival
90 km Range
-9... km To dest.
4.0 km/h Speed
39.5 l Consumpt.
RADIO3
TP
15:32
22.10.2026





Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be includ may be omitted.

Vehicle Identity & History		
Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked
Exterior Condition		
Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected
Interior Condition		
Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked
Lights, Mirrors & Glass		
Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		
Comfort & Electronics		
Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	
Safety Equipment		
Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)
Engine Bay & Fluids		
Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	
Braking System		
Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	
Steering & Suspension		
Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		
Wheels & Tyres		
Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		
Exhaust & Fuel System		
Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		
Road Test & Driving Performance		
Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	