

Diagnosis report of 2020 PEUGEOT 308 Premium



Car details

Color: White	CO ₂ NEDC Emission: 101 g/km
Fuel type: Petrol	CO ₂ WLTP Emission: 130 g/km
Body type: Wagon	Gross Vehicle Weight (GVW): 1800 kg
Number of doors: 5	Engine size: 1.20 l
Number of seats: 5	Cylinders: 3
Mileage: 164 761 km	Power: 81 kw
VIN Code: VF3LRHNPJLS037782	Fuel consumption: 4.40 l/100km
Gearbox: Manual	Tire size: 205/55 - 16"
Drive type: Front-Wheel Drive	Longo Stock ID: N560209
Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of 2020 PEUGEOT 308 Premium



Diagnosis details

Mileage on completion date: 164 761 km
Checked by Longo Shared Service certified diagnostics team: Mindaugas Š., Arnas S.

This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.

Summary of diagnosed issues


During the comprehensive diagnosis conducted by Longo, 10 issues were identified in the vehicle.

Interior	Exterior	Mechanical
✔ 2 issues identified	✔ 2 issues identified	✔ 6 issues identified

Diagnosis process



OBD II diagnosis

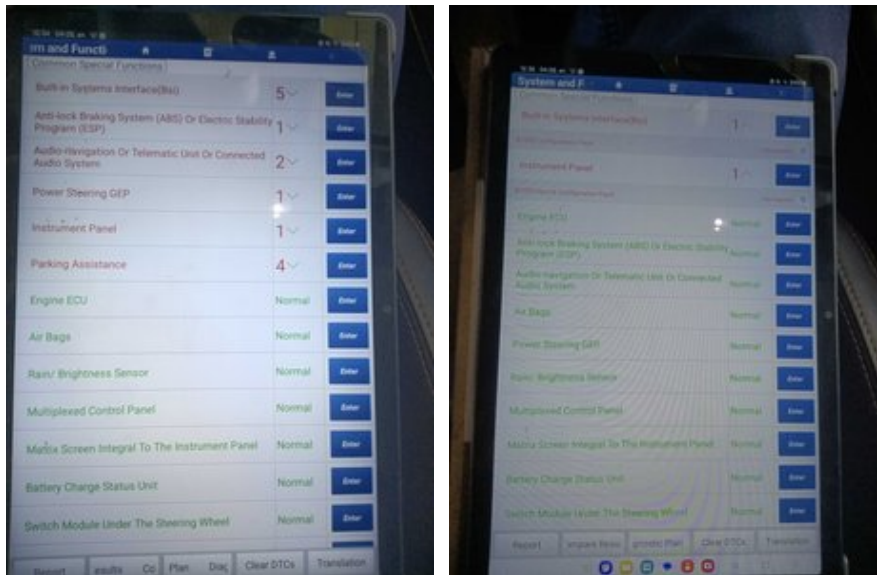

Interior

✓ 1. Inside: Trims - Condition



✓ 2. Front: Trims - Condition




Exterior

✓ 1. Side: Wheels - Condition



✓ **2. Rear:** Rear Bumper - Condition and Alignment

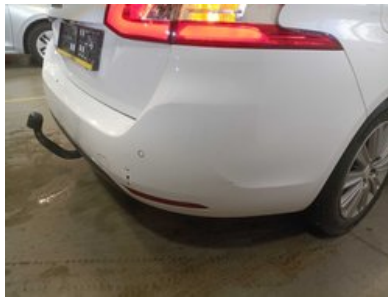

Mechanical

✓ **1. OTHER:** Rear Brake Disc and Pads



✓ 2. OTHER:



✓ 3. OTHER: Oil Drain Screw



✓ 4. OTHER: Front Brake Discs with Pads



✓ **5. OTHER:** Suspension Lower Arm





✓ **6. OTHER:** Lubricate Crankcase



Other

✓ 1. Diagnostic Photo

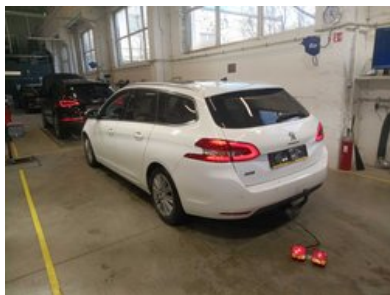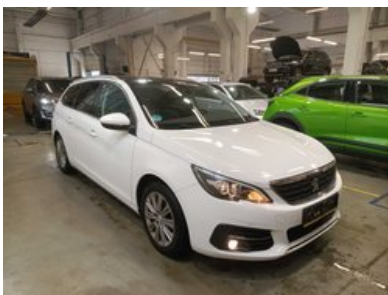

2. Brake Test Line Results



✔ 3. Add Photo of Front Interior



✓ 4. Air-Conditioning Measurement



Preparation and repair report of 2020 PEUGEOT 308 Premium



Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Mechanical repairs

- ✓ 1. Charge Battery
- ✓ 2. Oil Drain Screw
- ✓ 3. Lubricate Crankcase

Cleaning & polishing

- ✓ 1. Body wet wash
- ✓ 2. Full interior deep clean using only hypoallergenic cleaning products
- ✓ 3. Post cleaning body polish

Spare parts used during preparation

- 1. Oil Drain Plug (EL523470)

Disclaimer


This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.



Additional information about 2020 PEUGEOT 308 Premium



Additional pictures




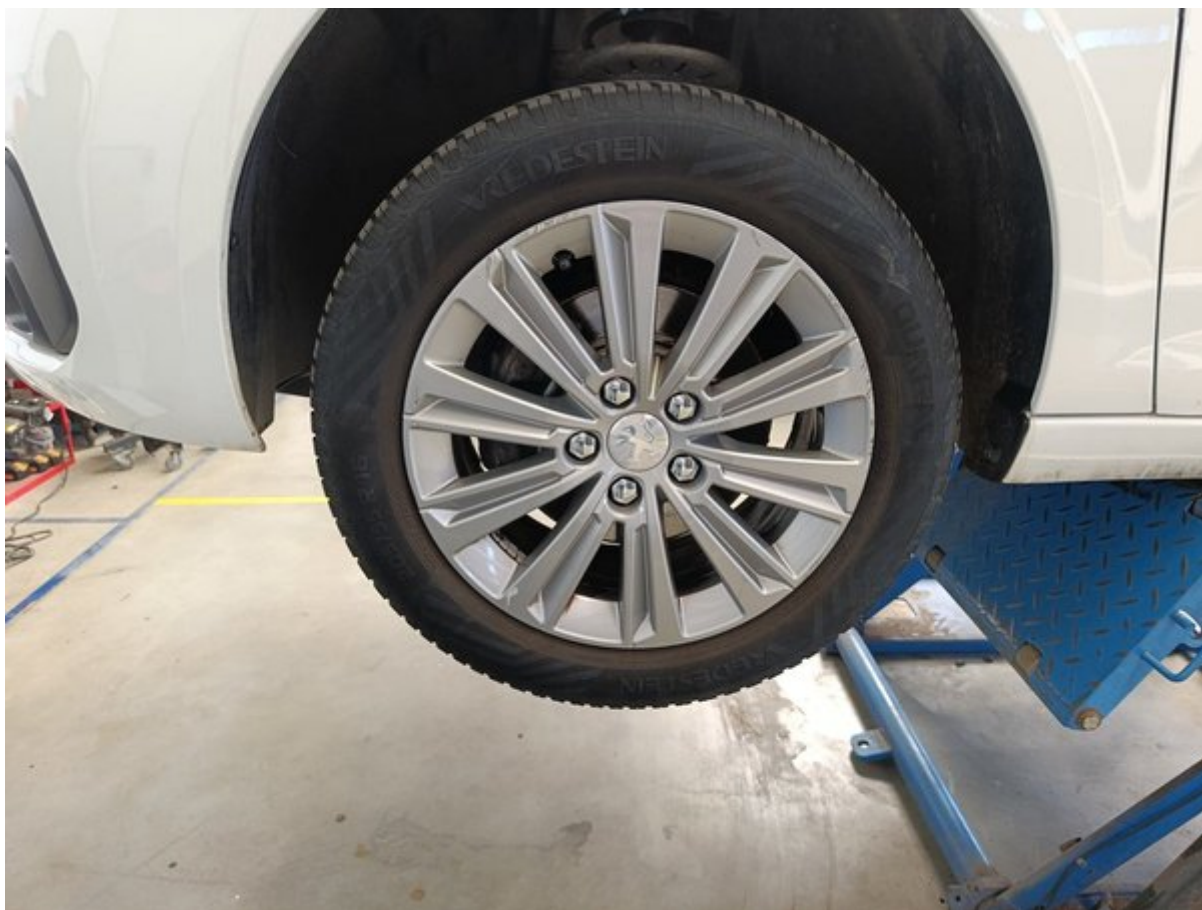

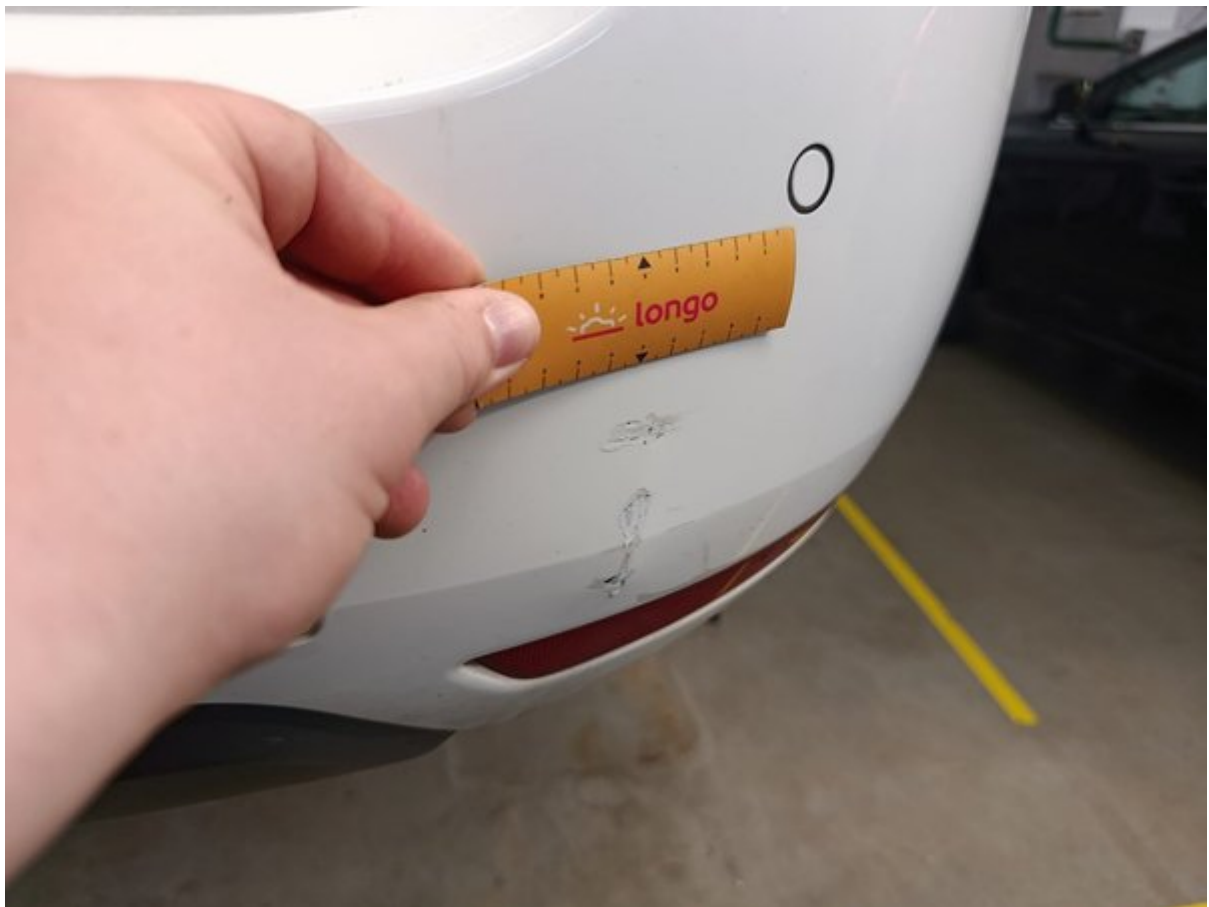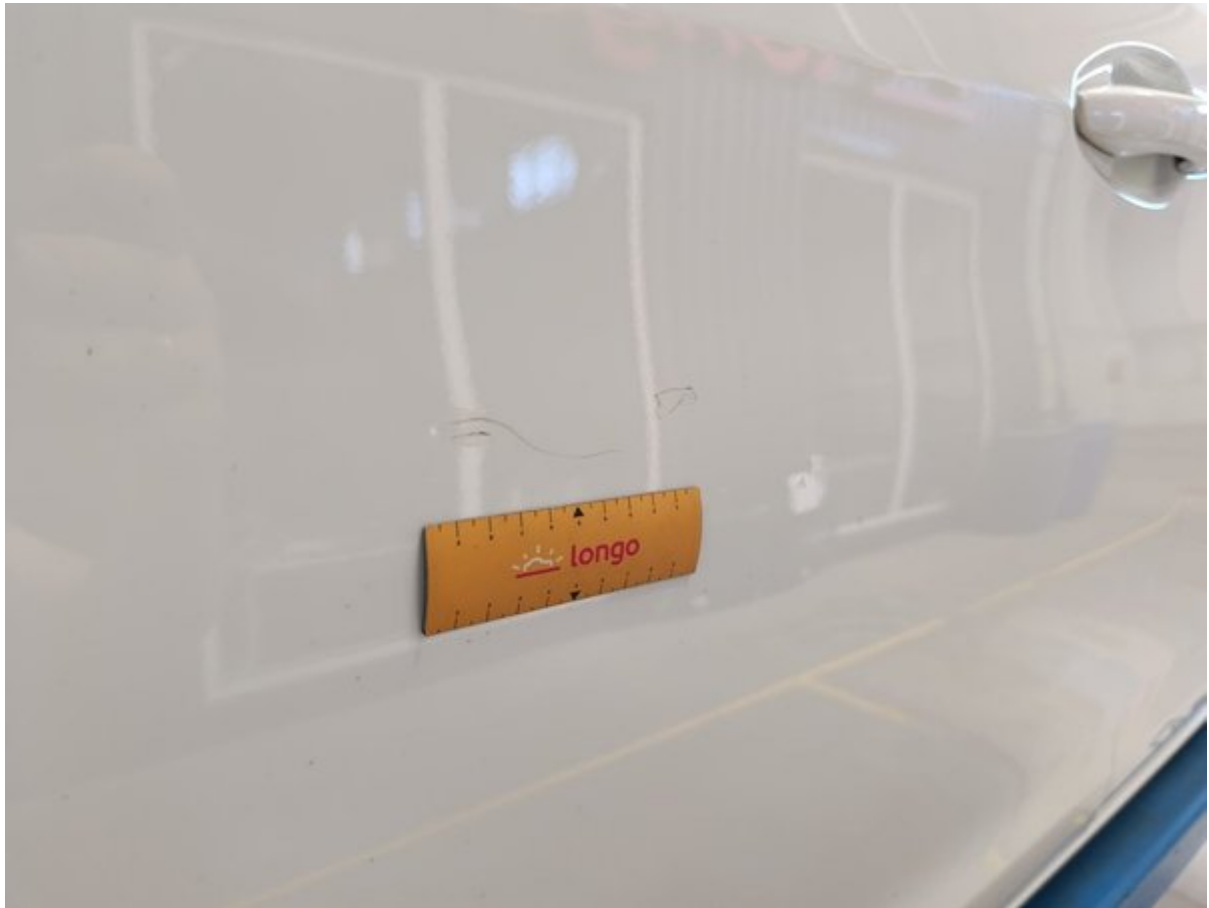





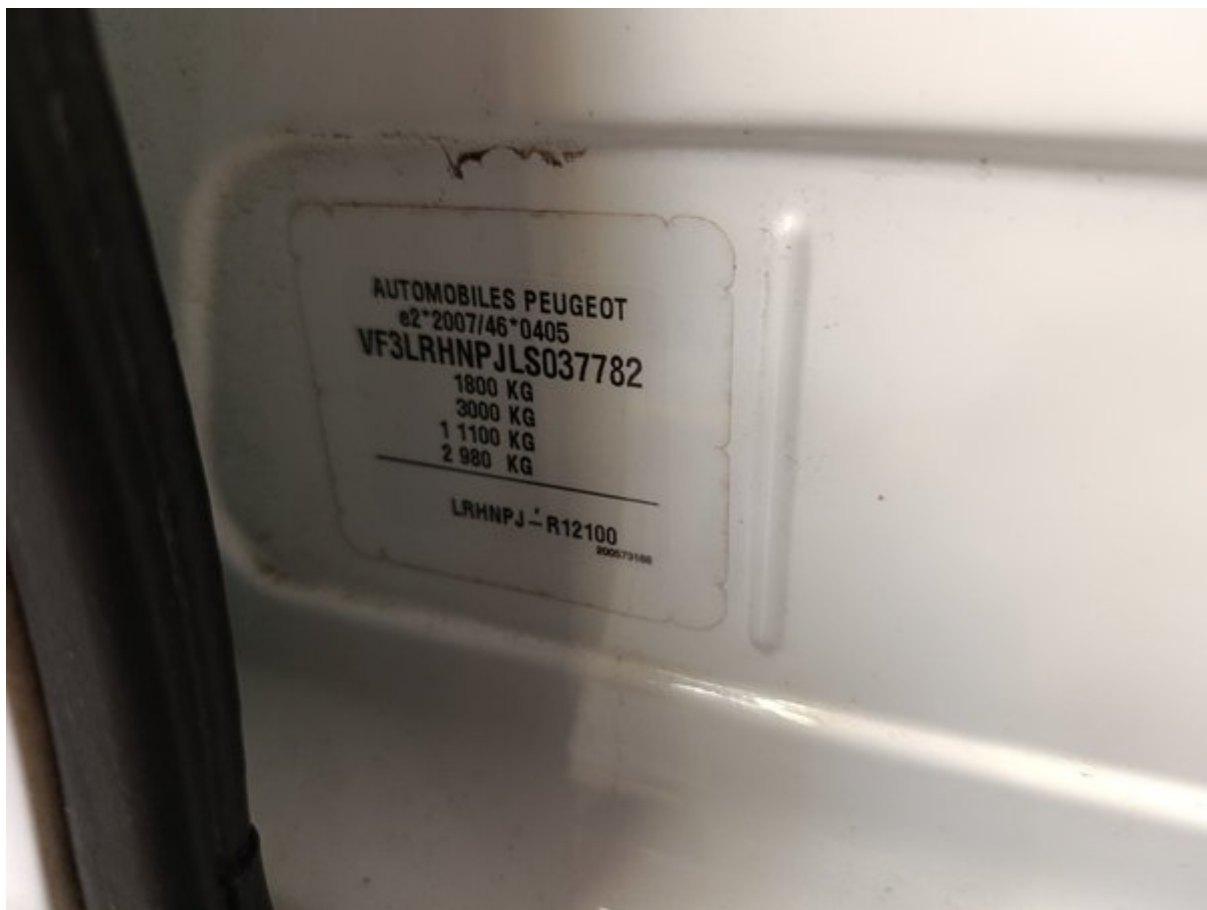



SERVICERECORD

Datum: 09.02.2022 km-stand: 163120

Normale Gebruiksomstandigheden ☐ Zware Gebruiksomstandigheden ☐

gk-beat & Brijbeke v.v.

Periodek onderhoud Dealerstempel

BORG bv autobedrijf
 Kaartenmakerstraat 9
 2984 CB Ridderkerk
 M 06 422 045 61 T 0180 397943
 www.autobedrijfborgo.nl

Volgende controle bij 173000 km of op 09.02.2022

Datum: / / km-stand: /

Normale Gebruiksomstandigheden ☐ Zware Gebruiksomstandigheden ☐

Periodek onderhoud Dealerstempel

Volgende controle bij km of op / /

Datum: / / km-stand: /

Normale Gebruiksomstandigheden ☐ Zware Gebruiksomstandigheden ☐

Periodek onderhoud Dealerstempel

Volgende controle bij km of op / /

* Welk van de twee als eerste wordt bereikt.

SERVICERECORD

Datum: 25.5.23 km-stand: 65961

Normale Gebruiksomstandigheden ☐ Zware Gebruiksomstandigheden ☒

W.B. + Rem. Willem

Periodek onderhoud Dealerstempel

WILLEM CORNELISSEN
 Verweg 3-4/2 AS Beend. + 01345 08 300

Volgende controle bij km of op / /

Datum: / / km-stand: /

Normale Gebruiksomstandigheden ☐ Zware Gebruiksomstandigheden ☐

Periodek onderhoud Dealerstempel

WILLEM CORNELISSEN
 Verweg 3-4/2 AS Beend. + 01345 08 300

Volgende controle bij km of op / /

Datum: 23.07.2026 km-stand: 142829

Normale Gebruiksomstandigheden ☒ Zware Gebruiksomstandigheden ☐

Bronnen v.o.w. - Willem

Periodek onderhoud Dealerstempel

BORG bv autobedrijf
 Kaartenmakerstraat 9
 2984 CB Ridderkerk
 M 06 422 045 61 T 0180 397943
 www.autobedrijfborgo.nl

Volgende controle bij 162000 km of op 23.07.2026

PSA GROUPE Courroie distribution / Timing belt changée / changed

km/miles 83135

Date 071123

Prochain changement / Next change : MAX 100 000 kms / 62 500 miles / 6 years

Coller sur le moteur / Stick on the engine

Volgende controle bij km of op / /

* Welk van de twee als eerste wordt bereikt.

SERVICERECORD

De volgende pagina's zijn bedoeld voor het
bedrijfsstempel van de professionele autoreparateur
die uw PEUGEOT-auto onderhoud.
Zorg dat de onderstaande vakken (datum,
kilometerstand, volgende onderhoudsbeurt, enz.)
worden ingevuld volgens uw gebruiksvoorwaarden
door de professionele autoreparateur die u hebt
gekozen.


U wordt aangeraden eventuele facturen of
documenten in verband met werkzaamheden aan
uw auto te bewaren.
Als de auto wordt doorverkocht, moeten deze aan de
nieuwe eigenaar worden gegeven, samen met alle
documenten die te maken hebben met de auto.

Het laten uitvoeren van de
routineonderhoudsbeurten is een dwingende
eis om te voldoen aan de voorwaarden van de
contractuele PEUGEOT-garantis.

Datum: 19.5.22	km-stand: 27224
Normale Gebruiksomstandigheden ☐	Zware Gebruiksomstandigheden ☐
Periodiek onderhoud Dealersstempel VERVOER 3-4-5-6-7-8-9-10-11-12-13-14-15-16-17-18-19-20-21-22-23-24-25-26-27-28-29-30-31-32-33-34-35-36-37-38-39-40-41-42-43-44-45-46-47-48-49-50-51-52-53-54-55-56-57-58-59-60-61-62-63-64-65-66-67-68-69-70-71-72-73-74-75-76-77-78-79-80-81-82-83-84-85-86-87-88-89-90-91-92-93-94-95-96-97-98-99-100	
Volgende controle bij _____ km of op _____ / _____ *	

Datum: 31.10.22	km-stand: 44610
Normale Gebruiksomstandigheden ☐	Zware Gebruiksomstandigheden ☐
Periodiek onderhoud Dealersstempel VERVOER 3-4-5-6-7-8-9-10-11-12-13-14-15-16-17-18-19-20-21-22-23-24-25-26-27-28-29-30-31-32-33-34-35-36-37-38-39-40-41-42-43-44-45-46-47-48-49-50-51-52-53-54-55-56-57-58-59-60-61-62-63-64-65-66-67-68-69-70-71-72-73-74-75-76-77-78-79-80-81-82-83-84-85-86-87-88-89-90-91-92-93-94-95-96-97-98-99-100	
Volgende controle bij _____ km of op _____ / _____ *	

* Welk van de twee als eerste wordt bereikt.

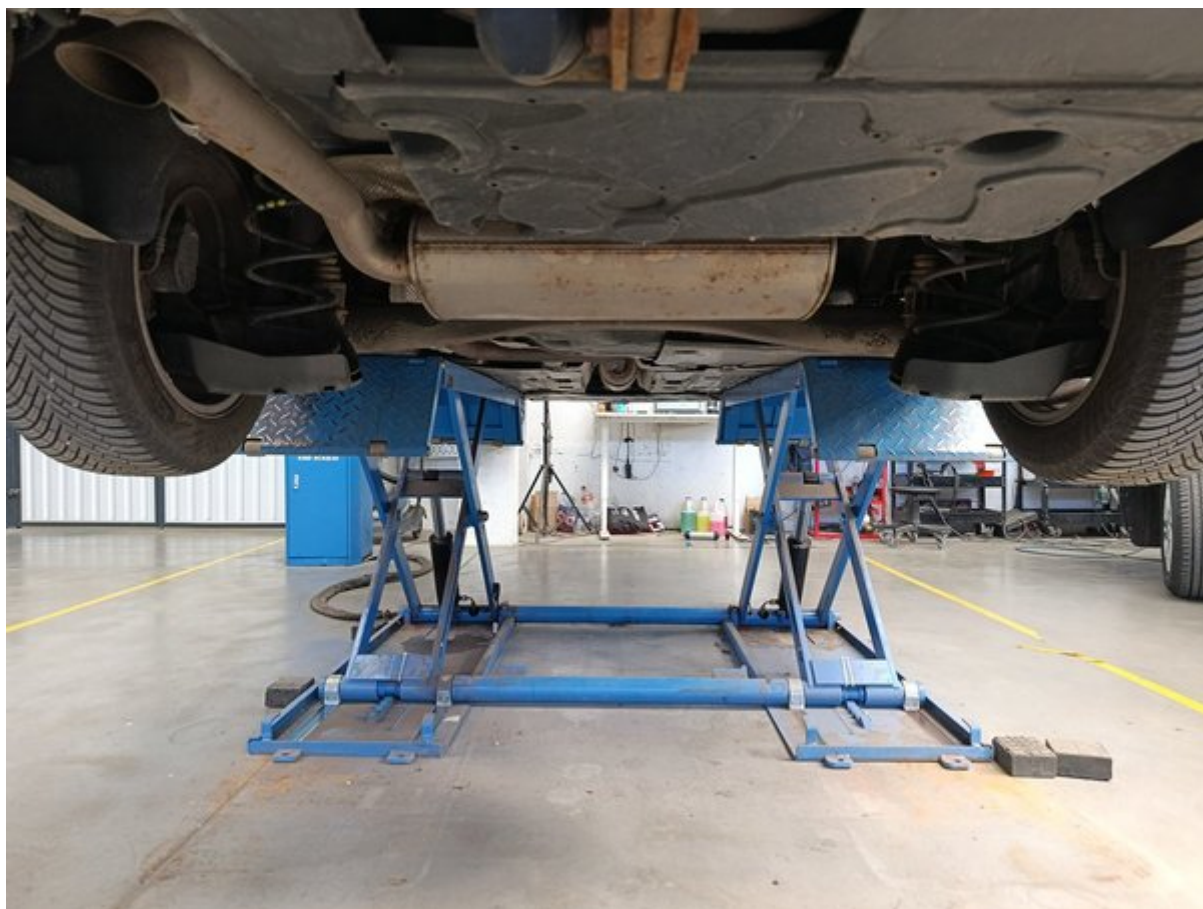



Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be included or omitted.



Vehicle Identity & History

Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked

Exterior Condition

Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected

Interior Condition

Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked

Lights, Mirrors & Glass

Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		

Comfort & Electronics

Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	

Safety Equipment

Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)

Engine Bay & Fluids

Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	

Braking System

Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	

Steering & Suspension

Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		

Wheels & Tyres

Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		

Exhaust & Fuel System

Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		

Road Test & Driving Performance

Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	