

Diagnosis report of 2017 VOLVO V70 Polar+



Car details

Color: Grey	CO ₂ NEDC Emission: 112 g/km
Fuel type: Diesel	
Body type: Wagon	Gross Vehicle Weight (GVW): 2290 kg
Number of doors: 5	Engine size: 2.00 l
Number of seats: 5	Cylinders: 4
Mileage: 248 055 km	Power: 110 kw
VIN Code: YV1BW7980G1376450	Fuel consumption: 4.30 l/100km
Gearbox: Automatic	Tire size: 205/60 - 16"
Drive type: Front-Wheel Drive	Longo Stock ID: N526183
Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of 2017 VOLVO V70 Polar+



Diagnosis details

Mileage on completion date: 248 055 km
Checked by Longo Shared Service certified diagnostics team: Arnas S., Mindaugas G.

This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.

Summary of diagnosed issues

During the comprehensive diagnosis conducted by Longo, 11 issues were identified in the vehicle.


Interior	Exterior	Mechanical
✔ 4 issues identified	✔ 1 issues identified	✔ 6 issues identified

Diagnosis process



Interior

- ✔ 1. Seats: All Seats - Condition

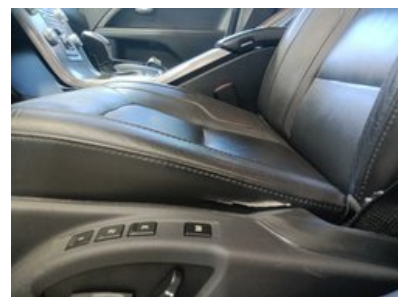

✓ **2. Doors:** Trims - Condition



✓ **3. Front:** Trims - Condition



✓ **4. Front:** Dashboard - Condition and Button Operation



Exterior

✔ 1. Front: Front Bumper - Condition and Alignment



Mechanical


✔ 1. BODY - FRONT SECTION: Damage



✔ 2. OTHER: Change Tires



✓ **3. ENGINE MANAGEMENT - FUEL:** Intake Manifold

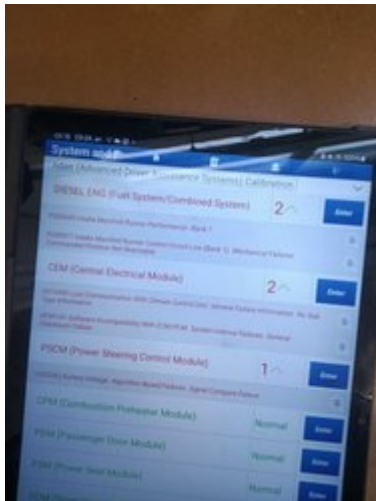

✓ **4. ENGINE:** Camshaft Valve Cover & Gasket



✓ **5. BRAKES:** Front Brake Pads (All)




✓ **6. BRAKES:** Rear Brake Disc (Both)



Other

✓ **1. Brake Test Line Results**

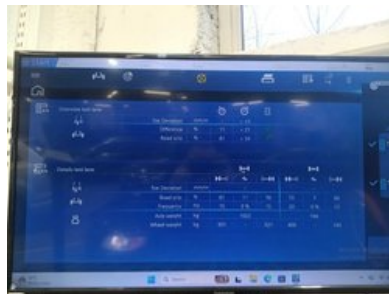

✓ **2. Diagnostic Photo**



✓ 3. Air-Conditioning Measurement



✓ 4. Add Photo of Front Interior



Preparation and repair report of 2017 VOLVO V70 Polar+



Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Mechanical repairs

- ✓ 1. Camshaft/Valve Cover & Gasket
- ✓ 2. Change Tires
- ✓ 3. Intake Manifold
- ✓ 4. Front Brake Pads (All)

Cleaning & polishing

- ✓ 1. Body wet wash
- ✓ 2. Full interior deep clean using only hypoallergenic cleaning products
- ✓ 3. Post cleaning body polish

Spare parts used during preparation

- 1. Engine Head Cover Gasket (71-12279-00)
- 2. Engine Intake Manifold Gasket (71-12274-00)
- 3. Seal Kit, Injector Nozzle (DRM0189)
- 4. Brake Pads Kit (LP1967)
- 5. Continental 205/60R16 Summer Tire (CONTINENTAL 205/60R16 SUMMER)
- 6. Intake Manifold Gasket (71-12275-00)


Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Additional information about **2017 VOLVO V70 Polar+**



Additional pictures

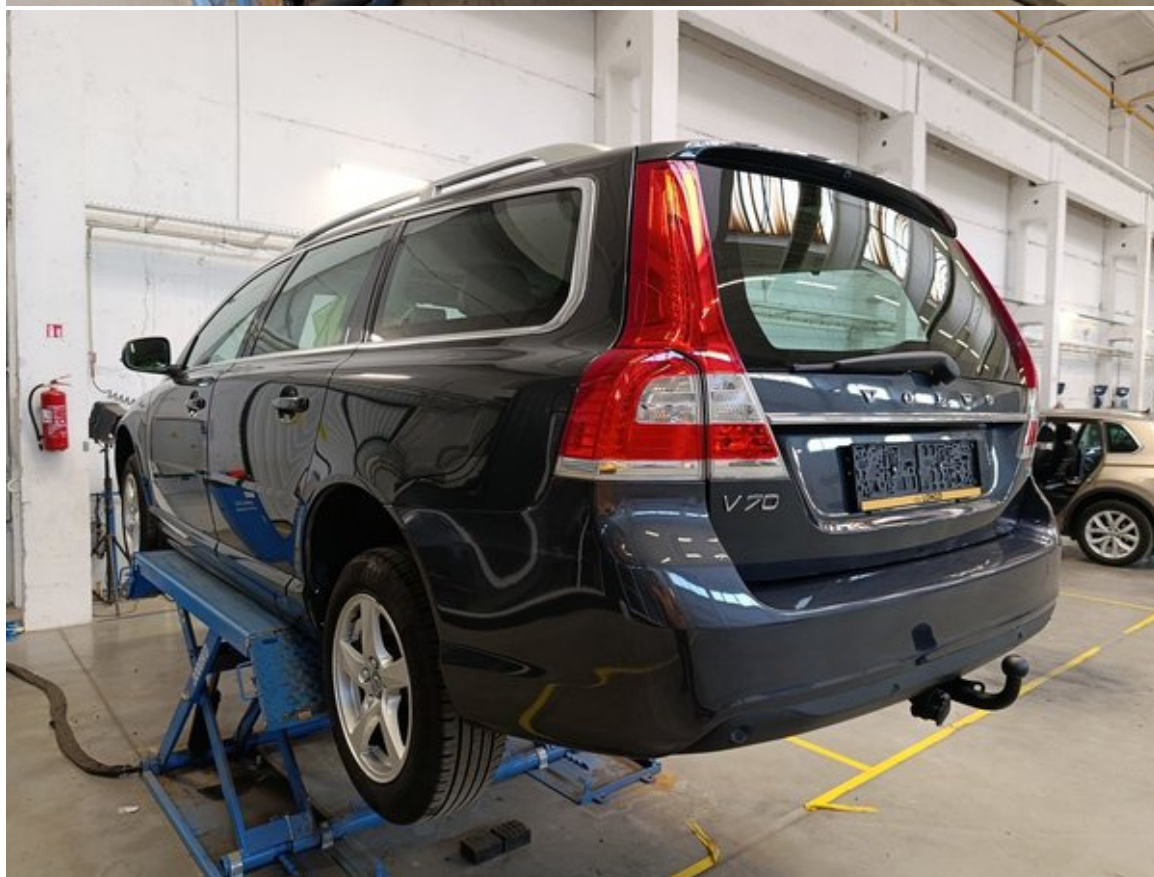














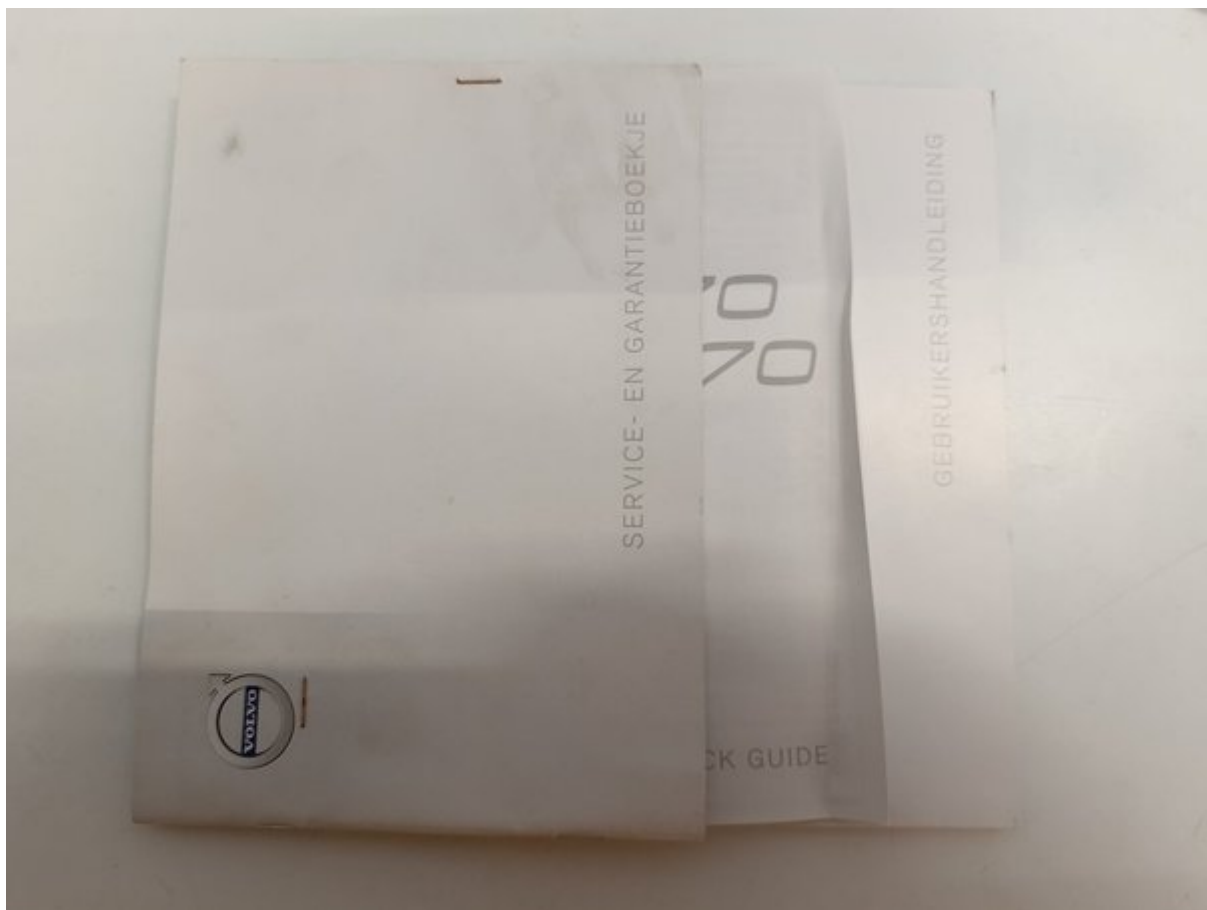

Servicebewijs

Zorg dat de formulieren na iedere onderhoudsbeurt worden afgetempeld en getekend door uw Volvo-dealer of Volvo Erkend Hersteler.

De Volvo-dealer kan u informeren over de inhoud van Volvo Original Service voor uw auto.

Vergeet niet onderhoud te verrichten volgens de onderhoudsintervallen.

Servicebeurt nr. 1

Kilometerstand: 31019
Datum: 20-0-2017
Werkorder nr.: 3349.303

Soort servicebeurt: **20**

Autobedrijf Rutten Roermond
Jacob Romenweg 5
6042 EZ Roermond
Tel: 0475 340765
E-mail: info@roermond.nl; info@autobedrijf Rutten.nl
Website: www.autobedrijf Rutten.nl

Extra verversings-/vervangingsbeurt olie/filtter: **STEMPEL**

Opmerking: **STEMPEL**

Servicebeurt nr. 2

Kilometerstand: 65642
Datum: 1-5-2010
Werkorder nr.: 3353030

Soort servicebeurt: **20**

Autobedrijf Rutten Roermond
Jacob Romenweg 5
6042 EZ Roermond
Tel: 0475 340765
E-mail: info@roermond.nl; info@autobedrijf Rutten.nl
Website: www.autobedrijf Rutten.nl

Extra verversings-/vervangingsbeurt olie/filtter: **STEMPEL**

Opmerking: **STEMPEL**

»

7

SERVICE EN ONDERHOUD

Servicebeurt nr. 3

Kilometerstand: 100903

Datum: 14-01-2019

Werkorder nr.: 3356603

Soort servicebeurt: **Autobedrijf Rutten Roermond**
Jacob Romenweg 5
6042 EZ Roermond
Tel. 0475-340765/Fax 0475-340765
E-mail: info@autobedrijfrutten.nl
Website: www.autobedrijfrutten.nl

Extra verversings-/vervangingsbeurt olie/filtter:

Opmerking:

Servicebeurt nr. 4

Kilometerstand: 138448

Datum: 12-11-2019

Werkorder nr.: 3360568

Soort servicebeurt: **Autobedrijf Rutten Roermond**
Jacob Romenweg 5
6042 EZ Roermond
Tel. 0475-340789/Fax 0475-340789
E-mail: info@autobedrijfrutten.nl
Website: www.autobedrijfrutten.nl

Extra verversings-/vervangingsbeurt olie/filtter:

Opmerking:

Servicebeurt nr. 5

Kilometerstand: 176399

Datum: 29-09-2020

Werkorder nr.: 3364410

Soort servicebeurt: **Autobedrijf Rutten Roermond**
Jacob Romenweg 5
6042 EZ Roermond
Tel. 0475-340789/Fax 0475-340789
E-mail: info@autobedrijfrutten.nl
Website: www.autobedrijfrutten.nl

Extra verversings-/vervangingsbeurt olie/filtter:

Opmerking:

SERVICE EN ONDERHOUD

Servicebeurt nr. 6

Kilometerstand: 18589

Datum: 4-10-21

Werkorder nr.:

Soort servicebeurt: **Volvo van der Schaaf Autobedrijven**
Official Dealer Volvocars
Leeuwarden, Drachten, Sneek en Heerenveen
www.vanderschaaf-friesland.nl

Extra verversings-/vervangingsbeurt olie/filtter:

Opmerking:

Servicebeurt nr. 7

Kilometerstand: 201883

Datum: 14-9-2022

Werkorder nr.:

Soort servicebeurt: **Volvo van der Schaaf Autobedrijven B.V.**
Official Dealer Volvocars
Leeuwarden, Drachten, Sneek, Heerenveen
www.vanderschaaf-friesland.nl

Extra verversings-/vervangingsbeurt olie/filtter:

Opmerking:

Servicebeurt nr. 8

Kilometerstand: 214415

Datum: 5-10-23

Werkorder nr.: 1248066

Soort servicebeurt: **Volvo van der Schaaf Autobedrijven B.V.**
Official Dealer Volvocars
Leeuwarden, Drachten, Sneek, Heerenveen
www.vanderschaaf-friesland.nl

Extra verversings-/vervangingsbeurt olie/filtter:

Opmerking:

SERVICE EN ONDERHOUD

Servicebeurt nr. 9

Kilometerstand 225979

Datum 23-9-24

Werkorder nr. 1255407

Soort servicebeurt

Reguliere service

Volvo van der Schaaf Autobedrijven B.V.
 Official Dealer Volvocars
 Leeuwarden, Drachten, Sneek, Heerenveen
www.vanderschaaf-friesland.nl

Extra vervangings-/vervangingsbeurt olie/filtre:

STEMPEL

Opmerking

STEMPEL

Servicebeurt nr. 10

Kilometerstand 241740

Datum 17-09-2025

Werkorder nr. 1261729

Soort servicebeurt

Reguliere service

Volvo van der Schaaf Autobedrijven B.V.
 Official Dealer Volvocars
 Leeuwarden, Drachten, Sneek, Heerenveen
www.vanderschaaf-friesland.nl

Extra vervangings-/vervangingsbeurt olie/filtre:

STEMPEL

Opmerking

STEMPEL

Servicebeurt nr. 11

Kilometerstand

Datum

Werkorder nr.

Soort servicebeurt

Reguliere service


Extra vervangings-/vervangingsbeurt olie/filtre:

STEMPEL

Opmerking

STEMPEL

10

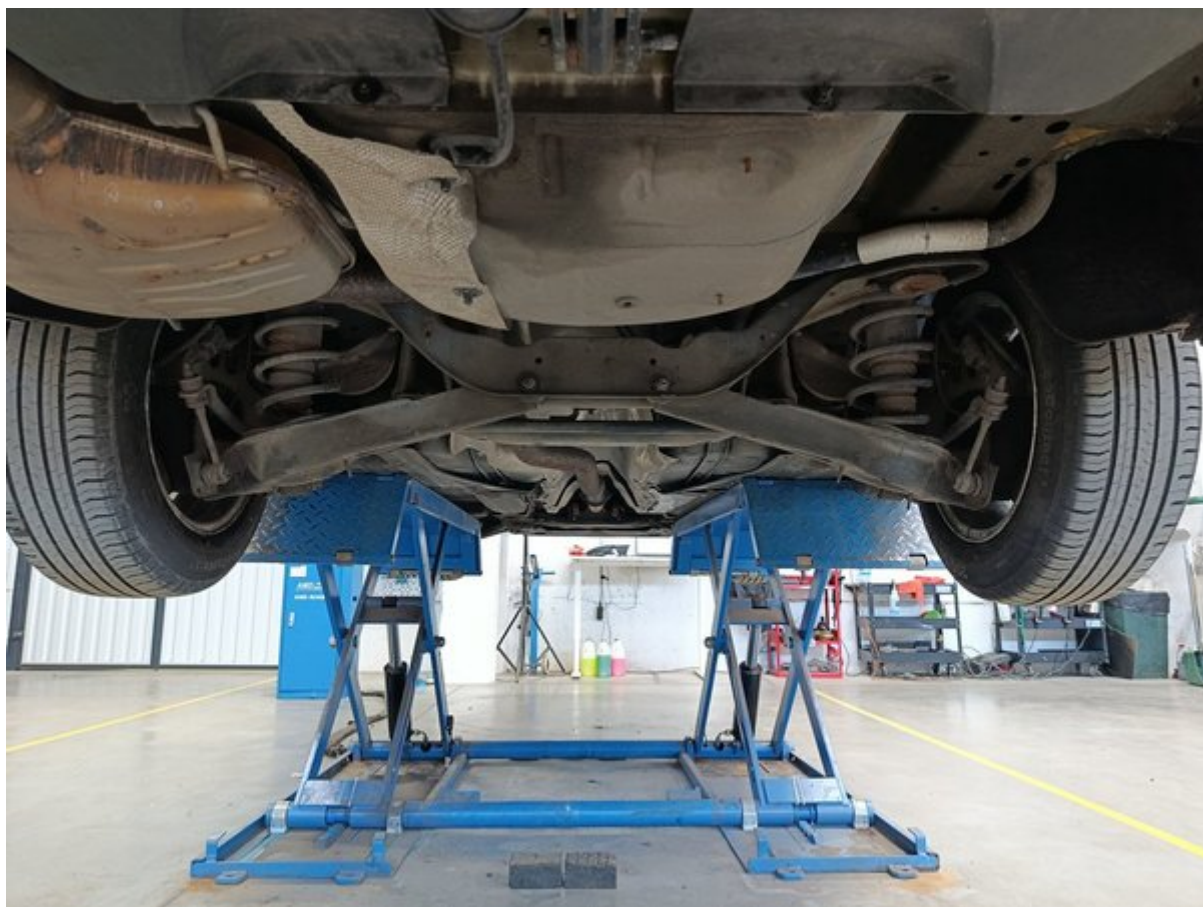



Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be included or omitted.



Vehicle Identity & History

Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked

Exterior Condition

Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected

Interior Condition

Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked

Lights, Mirrors & Glass

Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		

Comfort & Electronics

Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	

Safety Equipment

Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)

Engine Bay & Fluids

Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	

Braking System

Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	

Steering & Suspension

Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		

Wheels & Tyres

Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		

Exhaust & Fuel System

Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		

Road Test & Driving Performance

Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	